NISSAN NORTH AMERICA, INC.
Copyright ©

# SERVICE BULLETIN

| Classification: | Reference: | Date: |
|---|---|---|
| EC04-025 | NTB04-126 | October 29, 2004 |

# MUST CLEAR SELF-LEARNING AFTER REPAIRING DTC P1273/P1283 OR P1274/P1284 AIR FUEL LEAN OR RICH SHIFT

**APPLIED VEHICLES:** All Nissan's with DTC's P1273 / P1274 / P1283 / P1284

## IF YOU CONFIRM:

A MIL "ON" with <u>any</u> of the following DTC(s) stored:

- P1273 / P1283 (A/F Sensor Bank-1 / 2 —Lean Monitor)
- P1274 / P1284 (A/F Sensor Bank-1 / 2 —Rich Monitor)

## ACTIONS:

1. Repair the vehicle as necessary.
   - Refer to ASIST for diagnostic and repair information.

2. Clear the engine ECU Self-Learning.

   **IMPORTANT: If Self-Learning Is Not Cleared:**

   - The DTC may be stored again; even if no malfunction exists.
   - This could result in the customer returning with the same incident ("come-back" repair).

## CLAIMS INFORMATION

The procedure to clear ECU Self-Learning is part of the DTC repair and should not be claimed as a separate repair item.

**IMPORTANT:** The purpose of ACTIONS (above) is to give you a quick idea of the work you will be performing. You MUST closely follow the <u>entire</u> Service Procedure (starting on page 2) as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

**SERVICE PROCEDURE**

1. Repair the source of the lean condition (P1273/P1283) or rich condition (P1274/P1284).
   - Check ASIST for any specific incident bulletins that may apply to your vehicle.
   - As necessary, follow Service Manual (ESM) diagnostic and repair information.

2. Clear the engine Self-Learning. Use CONSULT-II as follows:

**START**(Nissan) **>>** **ENGINE** **>>**

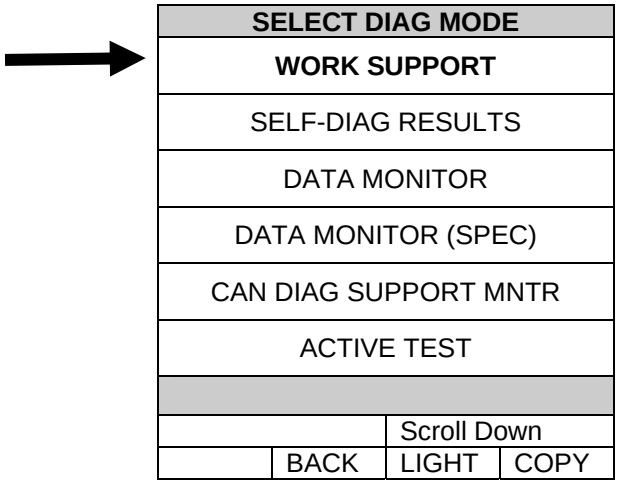


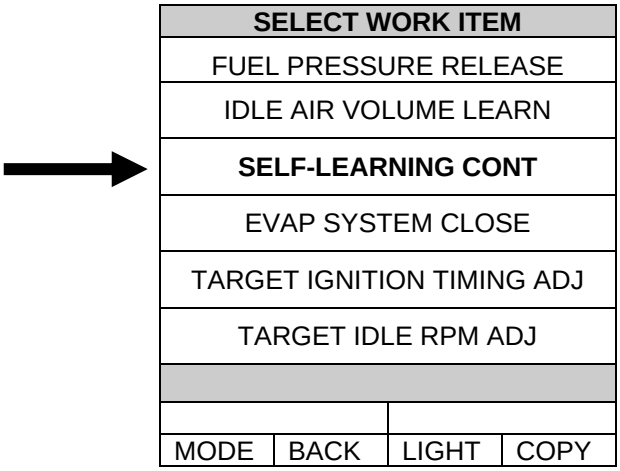

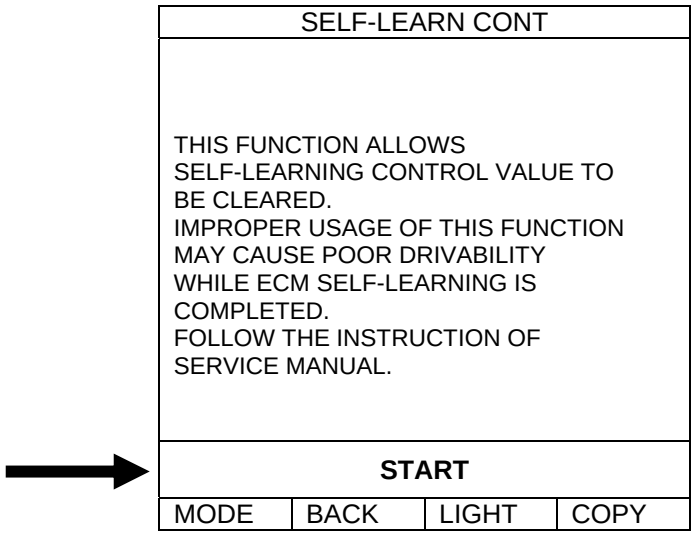


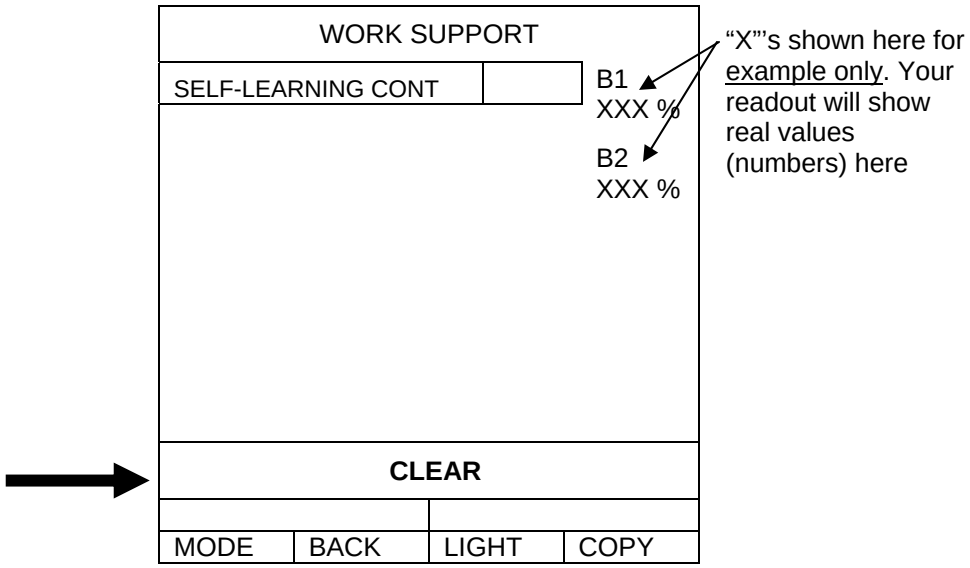

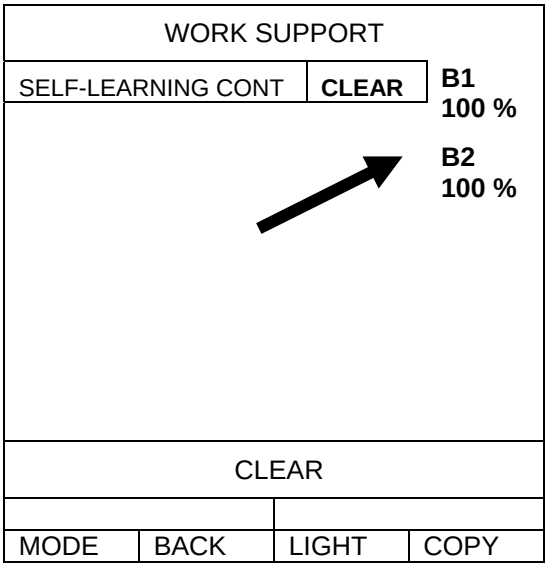
Readings of 100 % for B1 and B2 confirm that Self- Learning has been completed.